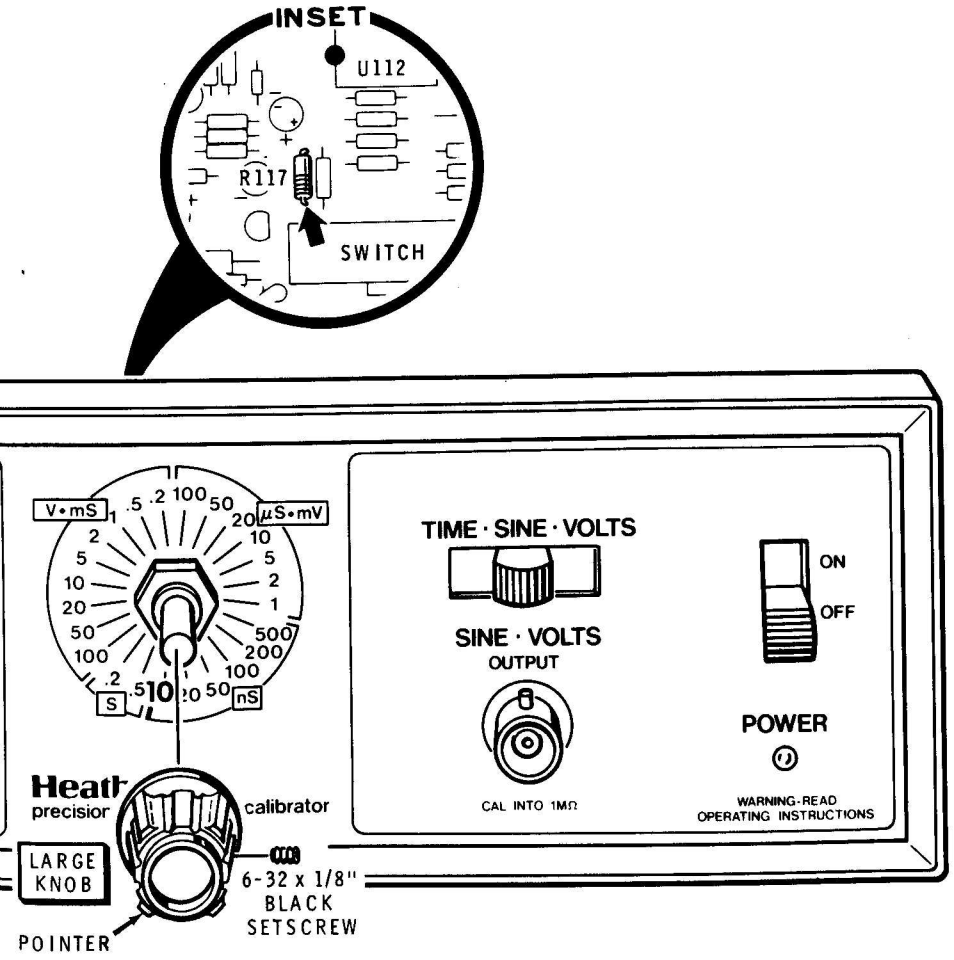
INSET
U112
R117
SWITCH
V•mS
μS•mV
S
nS
TIME · SINE · VOLTS
SINE · VOLTS
OUTPUT
CAL INTO 1MΩ
ON
OFF
POWER
WARNING-READ
OPERATING INSTRUCTIONS
Heath
precisior
calibrator
LARGE
KNOB
6-32 x 1/8"
BLACK
SETSCREW
POINTER

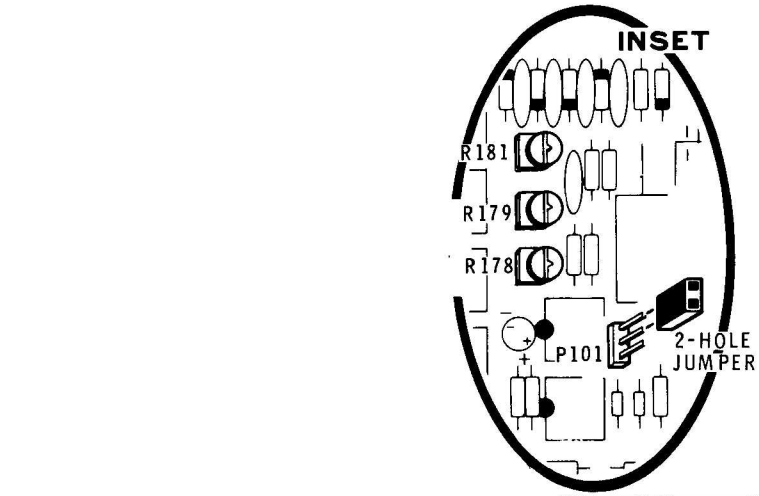
INSET
R181
R179
R178
P101
2-HOLE
JUMPER

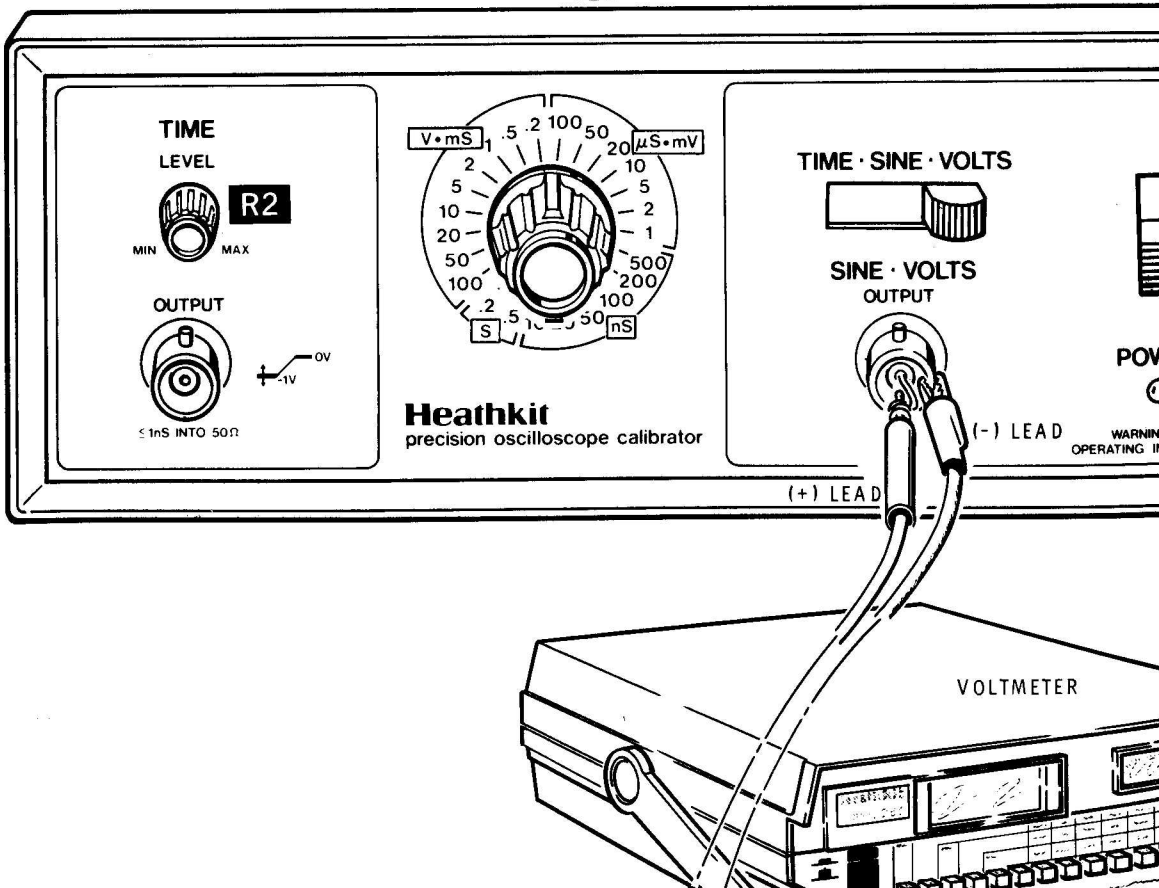
TIME
LEVEL
R2
MIN
MAX
OUTPUT
≤1nS INTO 50Ω
0V
-1V
V•mS
μS•mV
S
nS
Heathkit
precision oscilloscope calibrator
TIME · SINE · VOLTS
SINE · VOLTS
OUTPUT
(-) LEAD
(+) LEAD
VOLTMETER